VAPORMIST® EVAPORATIVE HUMIDIFIER
FACTORY WIRING DIAGRAM WITH VAPOR–LOGIC

DATE	REV	RECORD	DR
11/13	A	E.C.# 6157	JK
1/14	B	E.C.# 6172	JK

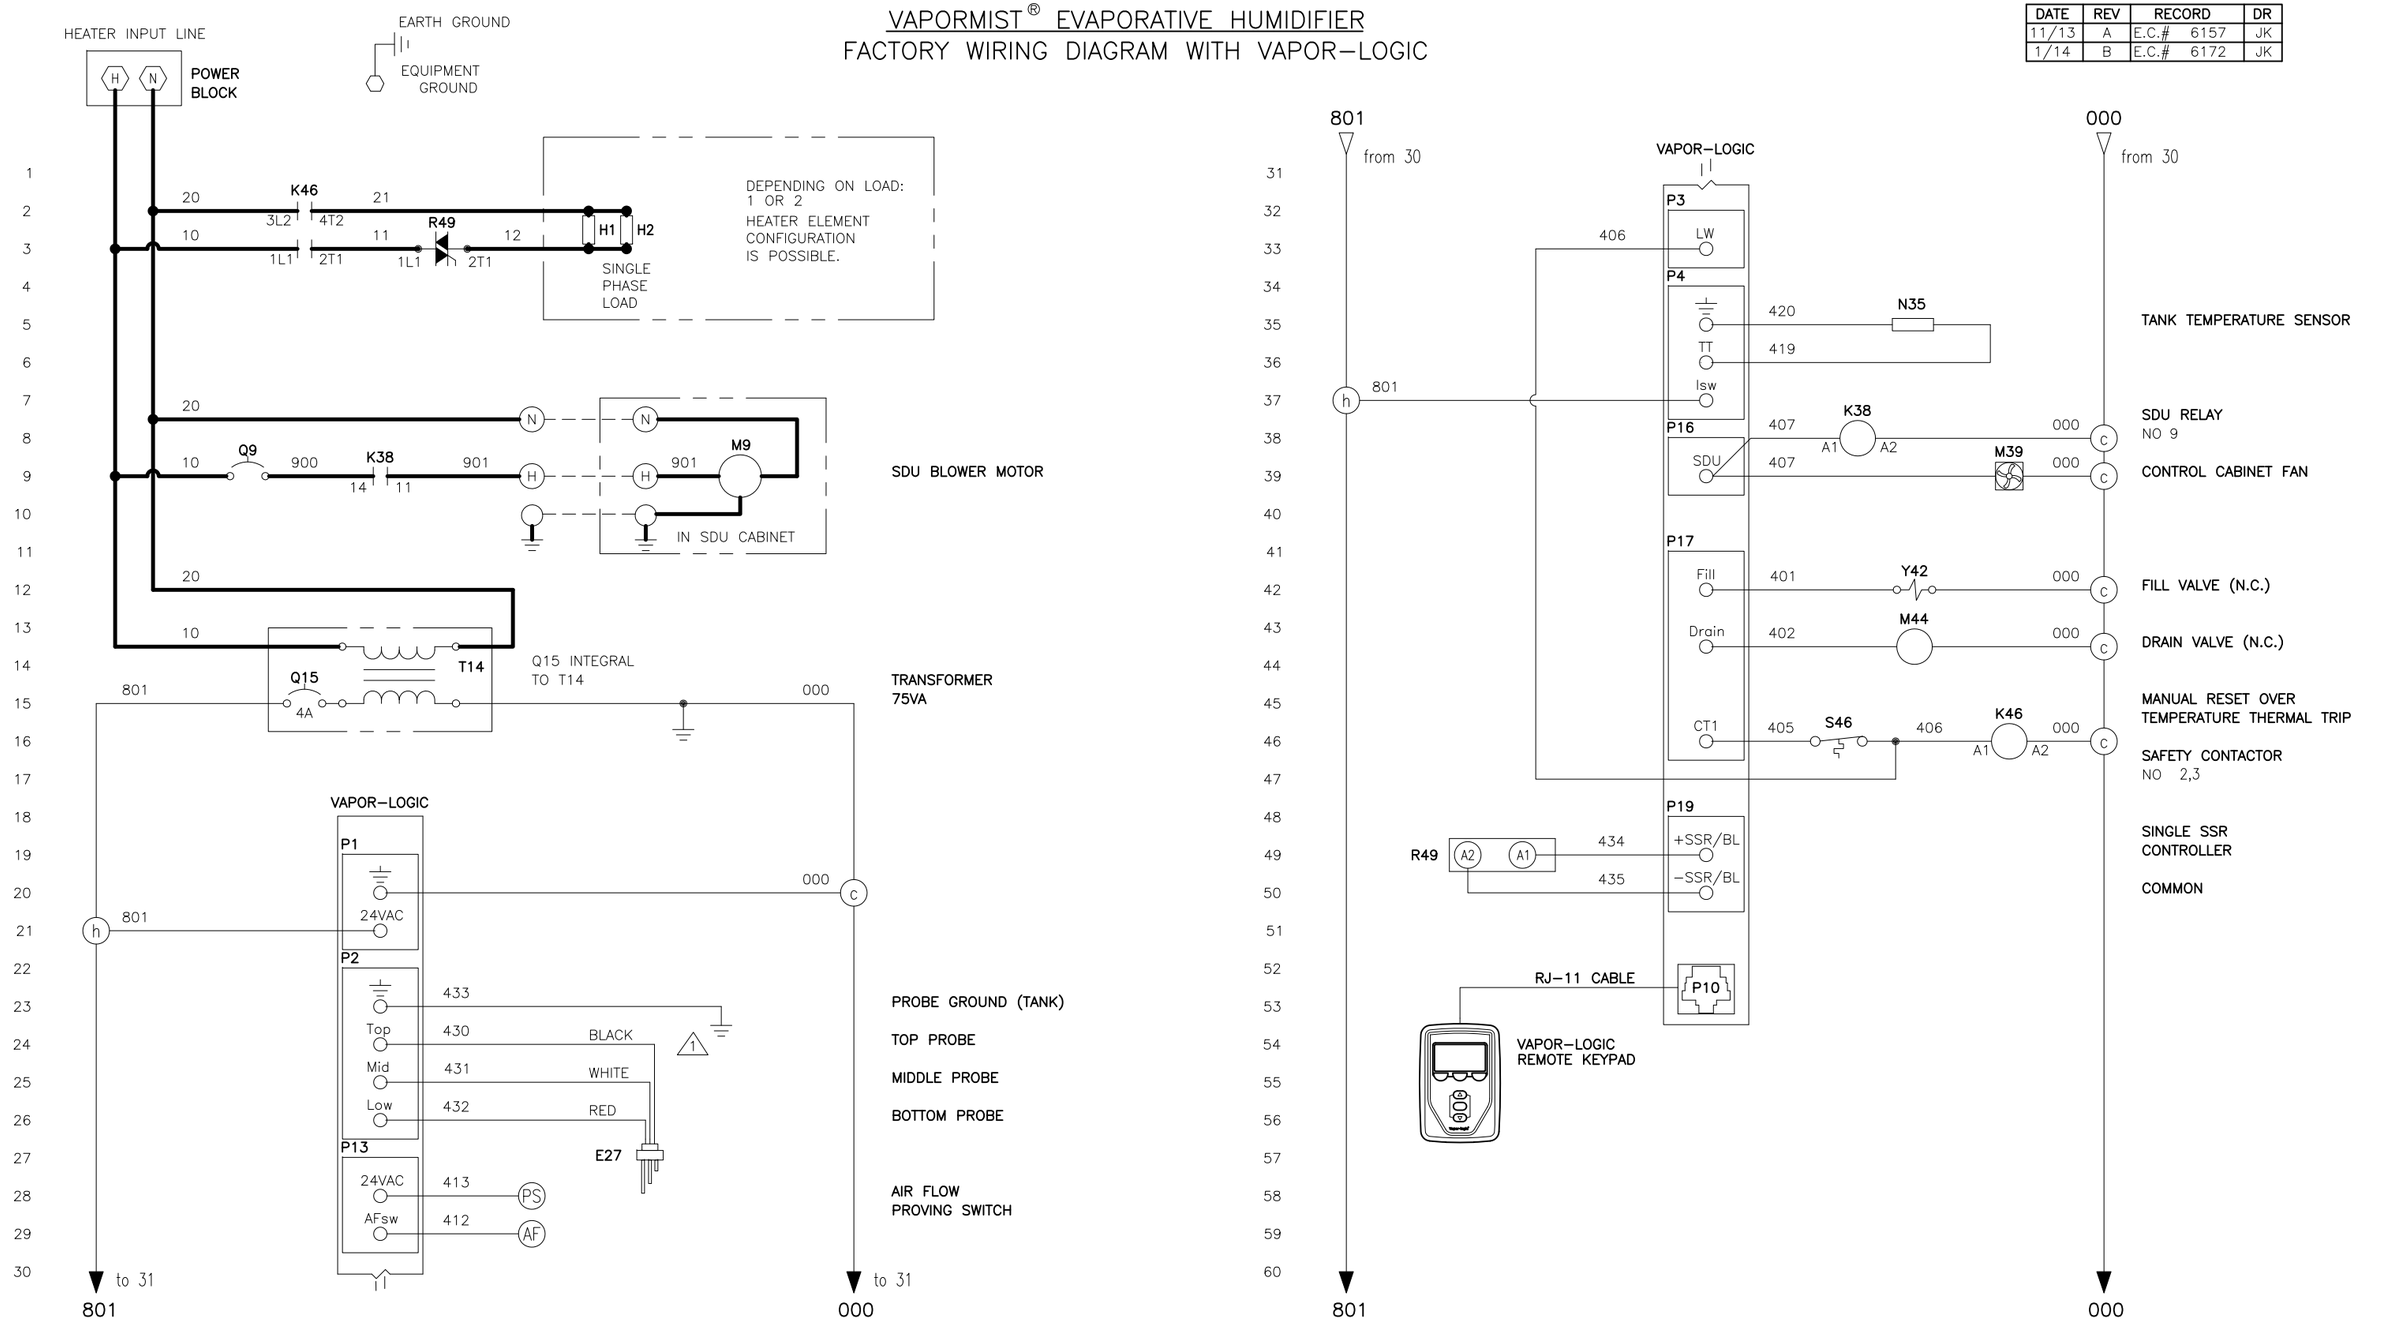

NOTES:

1. WATER LEVEL PROBE GROUND MUST BE CONNECTED TO TANK FOR PROPER HUMIDIFIER OPERATION.
2. REFER TO VM ELECTRICAL DATA SHEET.

POWER WIRING
CONTROL CIRCUIT WIRING
FIELD WIRING
OPTIONAL FACTORY
OPTIONAL FIELD

LEGEND

K	RELAY/CONTACTOR	Y	SOLENOID
T	TRANSFORMER	N	SENSOR
Q	CIRCUIT BREAKER	J	JUMPER
S	SWITCH	E	WATER PROBE
H	HEATER	M	MOTOR/FAN
F	FUSE	R	SOLID STATE RELAY

BREAK TO EXTERNAL CONNECTIONS DIAGRAM

driSteem™

VM, STANDARD WATER, SSR, SDU WIRING DIAGRAM 120 VOLT

MAT'L:
SCALE:
DRAWN BY: KROG
DATE: 11/5/13
P/N VM–VL5–38