
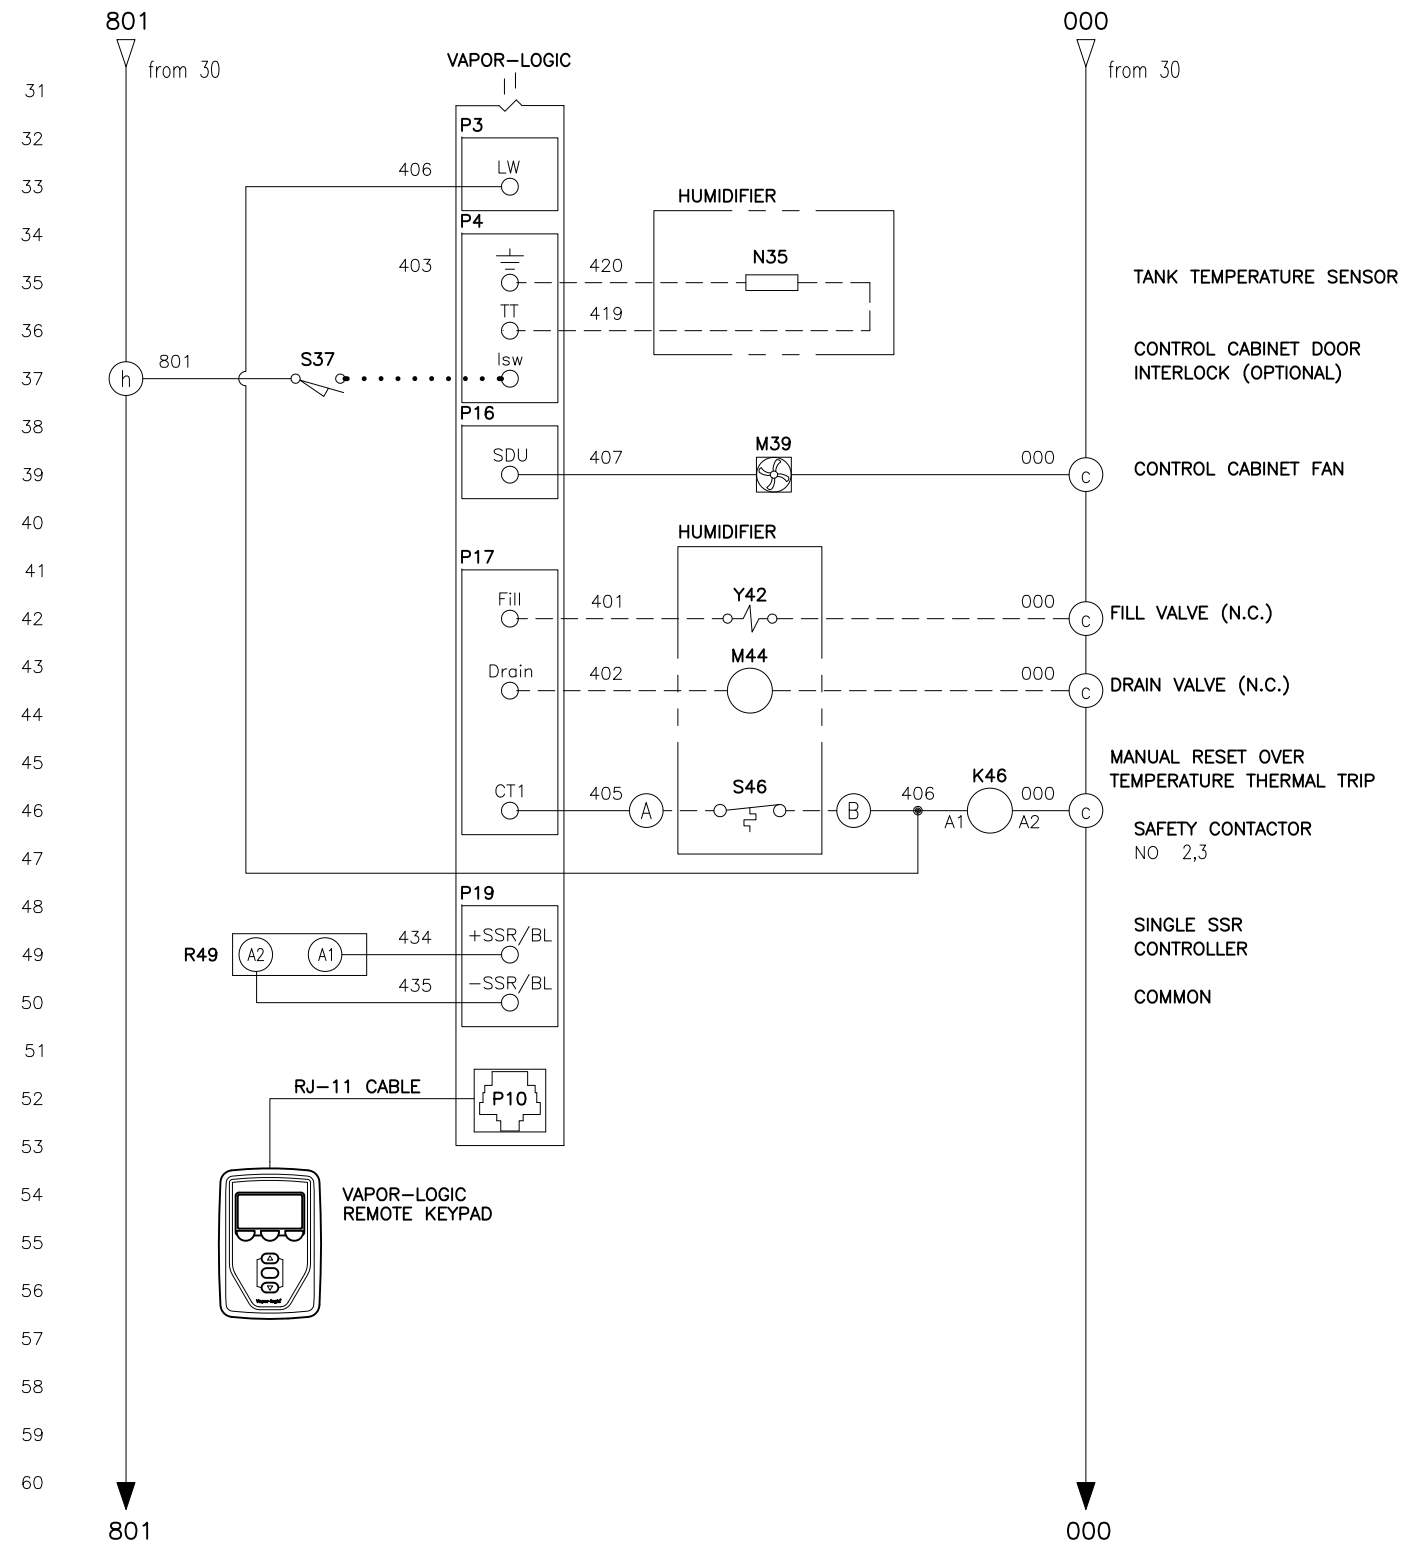


# CRUV™ EVAPORATIVE HUMIDIFIER FACTORY WIRING DIAGRAM WITH VAPOR-LOGIC FOR RN SERIES SSR'S

DATE	REV	RECORD	DR
11/13	C	E.C.# 6157	JK
11/13	D	E.C.# 6179	JK
3/14	E	E.C.# 6238	JK

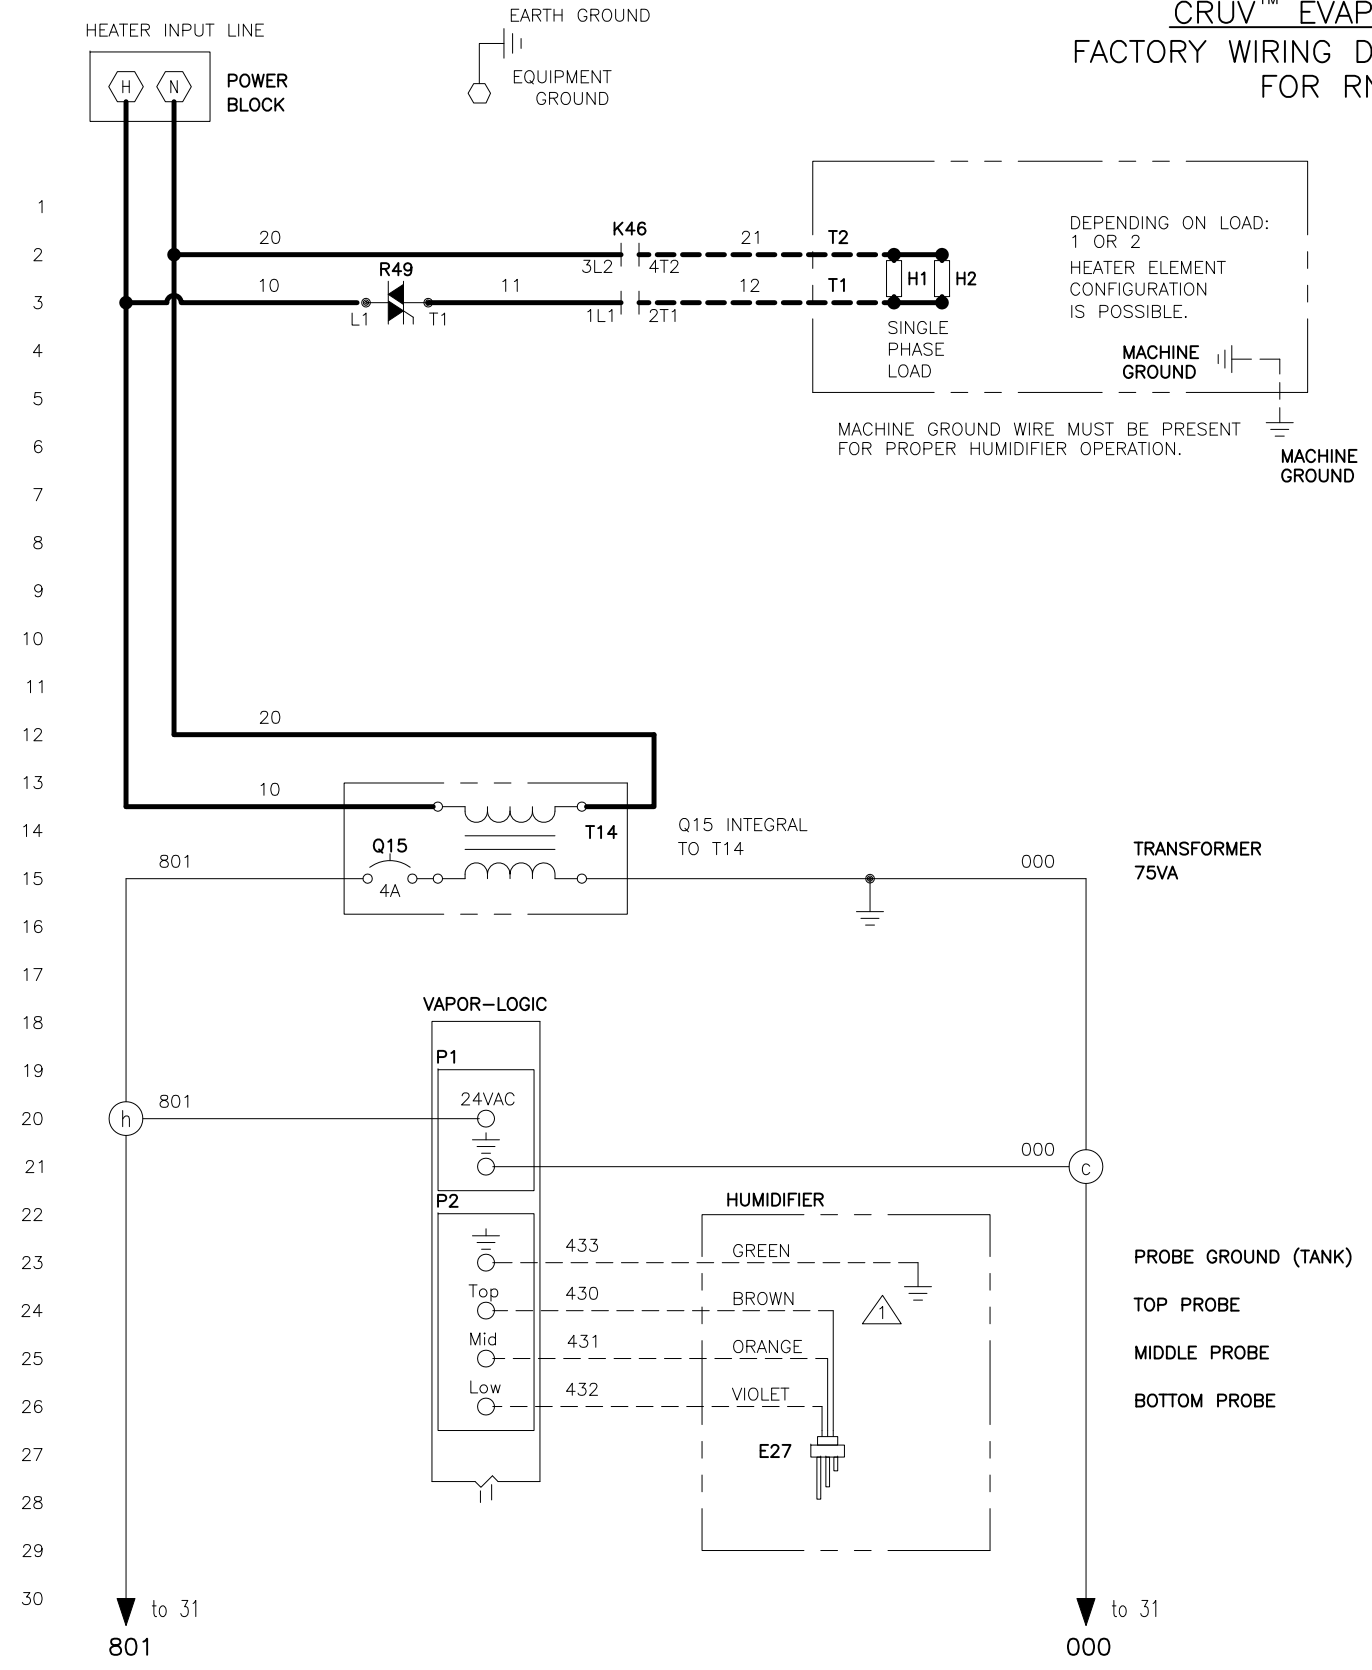

- NOTES:
- WATER LEVEL PROBE GROUND MUST BE CONNECTED TO TANK FOR PROPER HUMIDIFIER OPERATION.
  - REFER TO CRUV ELECTRICAL DATA SHEET.

**POWER WIRING**  
CONTROL CIRCUIT WIRING  
FIELD WIRING  
OPTIONAL FACTORY  
OPTIONAL FIELD

**LEGEND**

K	RELAY/CONTACTOR	Y	SOLENOID
T	TRANSFORMER	N	SENSOR
Q	CIRCUIT BREAKER	J	JUMPER
S	SWITCH	E	WATER PROBE
H	HEATER	M	MOTOR/FAN
F	FUSE	R	SOLID STATE RELAY

BREAK TO EXTERNAL CONNECTIONS DIAGRAM

<b>DOMESTIC CRUV, STANDARD WATER, SINGLE SSR 120 VOLT WIRING DIAGRAM</b>	
MAT'L:	
SCALE:	P/N
DRAWN BY: KROG	CR-VL5-13
DATE: 12/28/12	

